

Vehicle Inspection Report



OMAGH CENTRE

Reg: SN58KXL CN: YV1CT714691508901	Vat Status Standard (No Vat)	Vehicle Grade 4
---	--	---------------------------

Make: Volvo	Fuel: Diesel	Date First Reg: 30/09/2008
Model: XC90 R-Design D5 AWD Auto - 2.4	Transmission: Auto	Hand Controls: No
Engine Size: 2400	Gears:	Colour: Red
Engine No: 657224	Mileage: 170809	Wh Chair Adapt: No
Doors: 5	Yr of Manu: 2008	Sunroof: Standard
Body Type: Estate	Seats: 7	Parcel Shelf
Other:	Boot Mat: Yes	

Tyres	Interior Condition	Service History	Miscellaneous
Front Nearside: 2 mm	Carpets Front: Poor	Service History: No	V5: Here
Front Offside: 2 mm	Carpets Back: Poor	Last Service:	MOT: N/S
Rear Offside: 2 mm	Upholst Front: Poor	Stamps:	TAX:
Rear Nearside: 2 mm	Upholst Back: Poor	Mileage:	Taxed To:
Spare: No	Seats Front: Poor	Service Book: No	Master: No
Wheel Trims:	Seats Back: Poor		Spare: Yes No. Keys: 2

Extras	Cruise Control:	F P Sens:	ABS:	D Airbag:
Interior: Leather	Yes	No	Yes	
Stereo: Auto CD	Pwr Steering: Yes	R P Sens: Yes	M Paint: Yes	Bluetooth No
SD Card: No	M Func S Wh: Yes	Alloy W: Yes	P Airbag:	Phone kit: No
H/Seats: Yes	Elec Windows: 4	C Lock: Yes	Sat Nav: No	
	Elec Mirrors: Yes	Other:		



Front Angle



Rear Angle



Interior



Speedo Reading


Damage Location	Fault	Damage	Qty
Tyre nsf	Worn	Replace	1
Door osr	Scratched	PDR Smart Repair	1
Wheel nsf	Scratched	Repair and Refinish	1
Tyre osr	Worn	Replace	1
Tyre osf	Less Than 1.6mm	Replace	1
Tyre nsr	Less Than 1.6mm	Replace	1
Tailgate	Scratched	PDR Smart Repair	1
Door nsf	Chipped	PDR Smart Repair	1
Door osr	Rusted	PDR Smart Repair	1
Wheel osf	Corroded	Repair and Refinish	1
Bumper Front	Cracked	Repair and Refinish	1
Wing nsf	Scratched	Repair and Refinish	1
Door osf	Rusted	Repair and Refinish	1
Wheel nsr	Corroded	Repair and Refinish	1
Bonnet	Chipped	Refinish	1
Qtr Panel osr	Rusted	PDR Smart Repair	1

EXTERIOR CONDITION

X: Damage/Repl R: Rust
D: Dent C: Chipping
S: Scratch MS: Multiple Scratch
P: Previous K: Crack
PP: Poor Previous L: Light Mark/Scratch




stone chips on bonnet

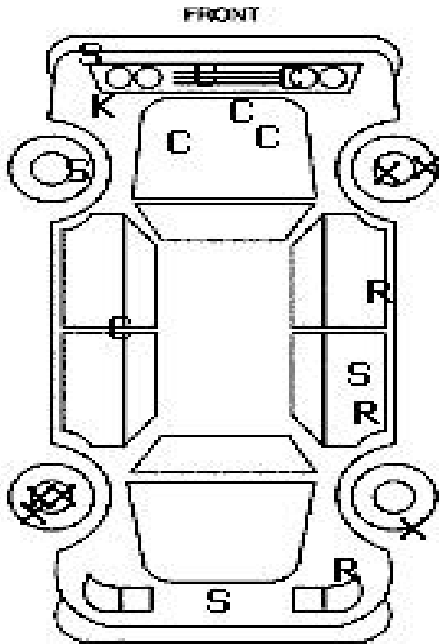

front bumper cracked

Comments:
Vehicle recorded damaged CAT C. Service light on and suspension issue. Display not visible on radio screen.

Print: Davy Boone
Date: 20/06/2019
Davy Boone

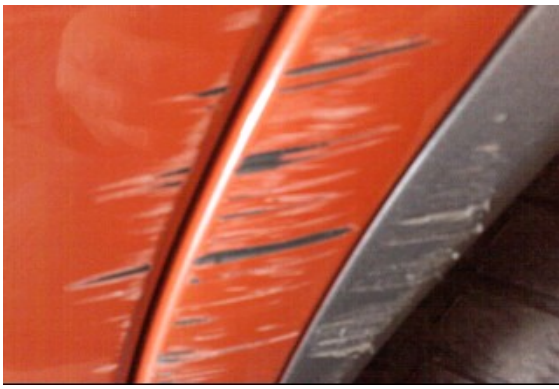

nsf wing arch scratched



osf door rusty



osr door rusty



osr quarter panel rusty




nsr alloy corroded



nsf alloy scratched



osf alloy corroded

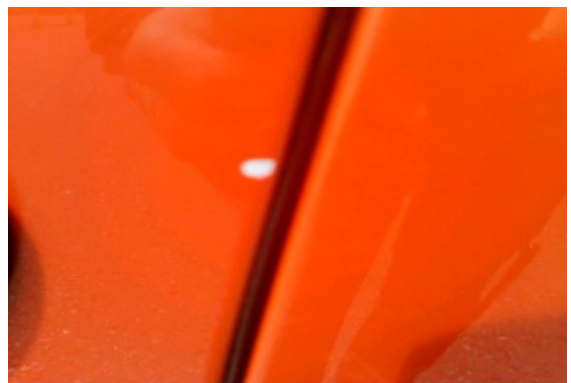

nsf door chipped

