

Vehicle Inspection Report



OMAGH CENTRE

Reg: DE13XHZ CN: VSSZZZ5FZDR034671	Vat Status Standard (No Vat)	Vehicle Grade 2
---	--	---------------------------

Make: Seat	Fuel: Diesel	Date First Reg: 14/05/2013
Model: Leon SE TDi - 2.0	Transmission: Manual	Hand Controls: No
Engine Size: 1968	Gears: 6	Colour: Red
Engine No: CKF004254	Mileage: 99881	Wh Chair Adapt: No
Doors: 5	Yr of Manu: 2013	Sunroof:
Body Type: Hatchback	Seats: 5	Parcel Shelf
Other:	Boot Mat: Yes	

Tyres	Interior Condition	Service History	Miscellaneous
Front Nearside: 4 mm	Carpets Front: Poor	Service History: Yes	V5: Here
Front Offside: 4 mm	Carpets Back: Poor	Last Service:	MOT: N/S
Rear Offside: 4 mm	Upholst Front: Average	Stamps: 4	TAX:
Rear Nearside: 3 mm	Upholst Back: Poor	Mileage: 63190	Taxed To:
Spare: Ho	Seats Front: Poor	Service Book: Yes	Master: No
Wheel Trims:	Seats Back: Poor		Spare: Yes No. Keys: 2

Extras	Cruise Control:	F P Sens:	ABS:	D Airbag:
Interior: Cloth	Yes	No	Yes	
Stereo: Auto CD	Pwr Steering: Yes	R P Sens: No	M Paint: Yes	Bluetooth Yes
SD Card: No	M Func S Wh: Yes	Alloy W: Yes	P Airbag:	Phone kit: No
H/Seats: No	Elec Windows: 4	C Lock: Yes	Sat Nav: No	
	Elec Mirrors: Yes	Other:		


Item 1:
Item 2:
Item 3:
Item 4:
Item 5:




Front Angle



Rear Angle

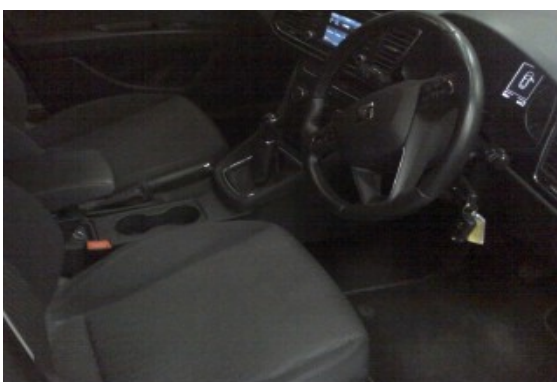

Interior

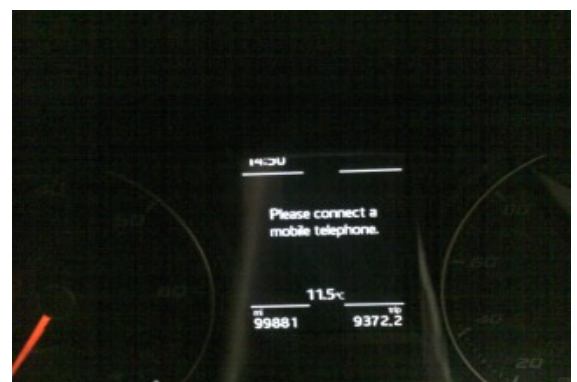


Speedo Reading

Damage Location	Fault	Damage	Qty
Door nsr	Scratched	PDR Smart Repair	1
Bumper Front	Chipped	Repair and Refinish	1
Qtr Panel osr	Dented	PDR Smart Repair	1
Bonnet	Chipped	Repair and Refinish	1
Bumper Rear	Scratched	Touch In Smart Repair	1

EXTERIOR CONDITION

X: Damage/Repl R: Rust
D: Dent C: Chipping
S: Scratch MS: Multiple Scratch
P: Previous K: Crack
PP: Poor Previous L: Light Mark/Scratch

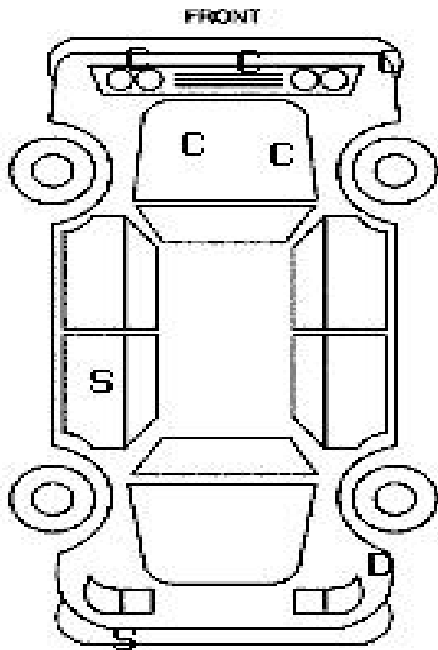

bonnet stone chips



rear bumper scratched

Comments:

Print: Davy Boone

Date: 24/03/2020

Davy Boone



nsr door scratched



front bumper stone chips



osr quarter panel dent

