

Vehicle Inspection Report

Date Inspected: 03/05/2019 08:49
Inspected By: 01

Reg: GF16MSV

VIN: WV1ZZZ7HZGH105344

Valuation

Cap Clean £11200
Cap Average £10350

NAMA Grading



Grade

3

Appraised By: CAG Rockingham

General Details

| | | | |
|------------------|---------------------------------------|-----------------------|------------|
| Make | Volkswagen | Transmission | Manual |
| Model | Transporter T28 Swb 2.0TDI BMT 102 | Gears | 5 |
| Body Type | Van | Date First Reg | 29/04/2016 |
| Mileage | 45,205 miles | Doors | 3 |
| Fuel Type | Diesel | Colour | White |
| | | Year of MFR | 2016 |

Tyres & Wheels

| | | | |
|------------------|---------|----------------------|----|
| OSF Depth | Average | Wheel Trims | |
| NSF Depth | Average | Alloys | No |
| OSR Depth | Average | Spare | |
| NSR Depth | Average | Tyre Comments | |

Interior Condition

| | |
|-------------------|---------|
| Carpets | Average |
| Upholstery | Average |
| Seats | Average |
| Odour | No |
| Comments | |

Miscellaneous

| | |
|---------------------|------------|
| V5 Location | T/F |
| MOT Location | VOSA |
| MOT Expiry | 28/04/2020 |

Extras

| | | | | | | | |
|-----------------------|--------|-------------------------|----|--------------------------|----|----------------------|----|
| Interior | Cloth | Air Conditioning | No | Sun Roof | No | Xenons | No |
| Seats | Manual | Climate | No | Front Park Assist | No | Towbar | No |
| Cruise Control | No | Sat Nav | No | Rear Park Assist | No | Keyless Entry | No |
| Bluetooth | No | | | | | | |


Service History

Service No History Stamps

Photos



Damage Assessment

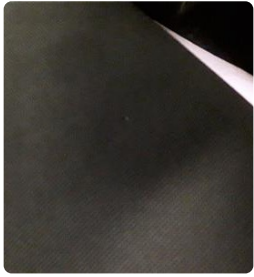

Seat Base Cover osf

Burn
UpTo 3mm
Smart Repair



Bonnet

Chipped
1 To 5
Smart Repair




Wing nsf

Dented
Over 30mm
Repair and Refinish




Bumper Front

Insecure
Action Required
Smart Repair

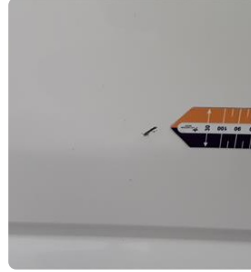


Door nsf

Scratched
UpTo 25mm Thru Paint
Smart Repair

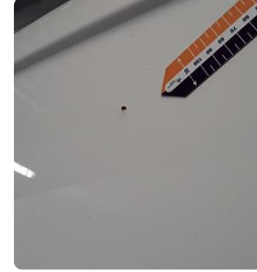

Tailgate


Dented
With Paint Damage
Repair and Refinish

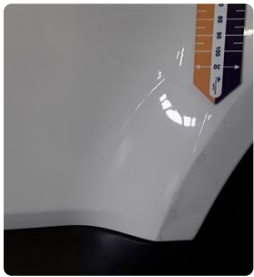

Qtr Panel osr

Poor Previous Repair
Poor Paint
Refinish

Vehicle Splat

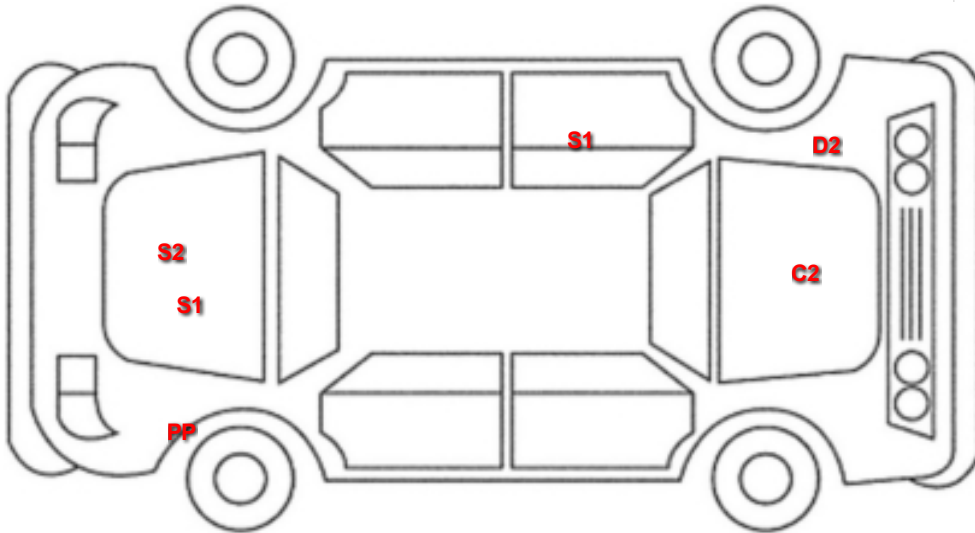

Splat Key

- S1**
Scratch/Paint defect to 30mm
- S2**
Scratch/Paint defect 30-100mm
- D2**
Dent/damage 30-100mm
- C2**
Multiple Chips
- PP**
Poor Previous

Comments